



Section 6

Parts List


AL Model

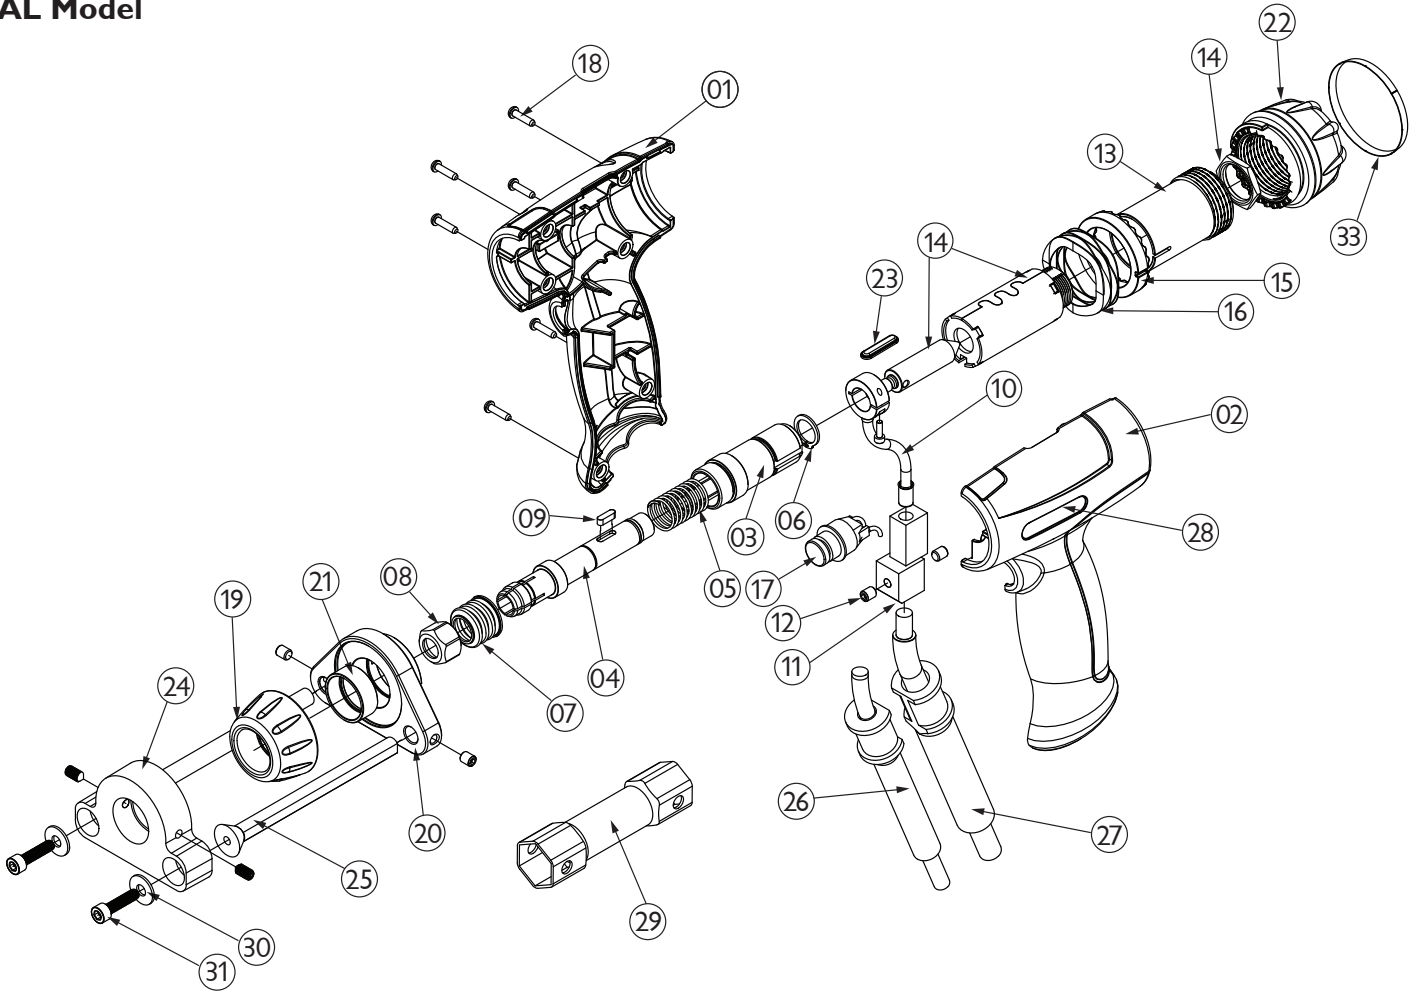

AL Weld Tool Part Numbers				
		Control Connector		
		Screw	R&S	Hubble
Weld Connector	Cam lok	GRGAC-09	GRG2C-09	GRG8C-09T
	Dinse	GRGAW-09	GRG2W-09	GRG8W-09T

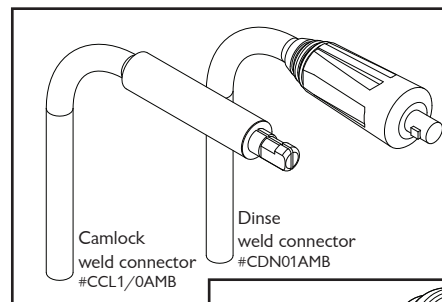

	Control Connector			Weld Connector	
	Screw	R&S	Hubble	Cam Lok	Dinse
Connector Only	CSS4AM	CRS4AM	CHB2AM	CCL1/0AMB	CDN01AMB
Cable Assembly	CC2BA-10	CC1B2-10	CC1B6-10	CW1VC-09	CW1VW-09

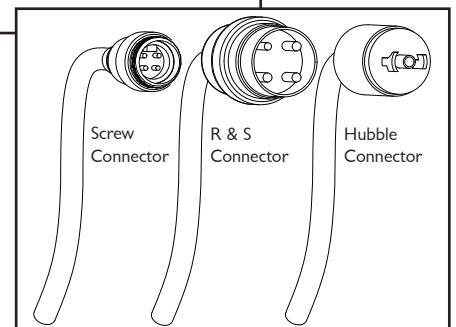

Section 6

Parts List

AL Model

Item	Description	Part Number
01	Weld Tool Body Right Side	GRB1
02	Weld Tool Body Left Side	GRB2
03	Spindle Bearing Assembly	GRM15
04	Spindle	GRM80
05	Gap Tool Main Spring	GRM23
06	Retaining Ring	GRM81
07	Bellows	GRM14
08	Collet Nut	GRM13
09	Key	GRM83
10	Internal Weld Cable Assembly	GRE30
11	Weld Cable Anchor	GRM32
12	Cup Point Set Screw M5X6	SSC5-6CP
13	Solenoid Sleeve	GRM42
14	Gap Solenoid with Nut	GRE4
15	Clutch	GRM40
16	Clutch Spring	GRM11
17	Trigger Switch	GAE1
18	Thread Forming Screw M3-12	TFC3-12ZP
19	Face Plate Nut	GRB17
20	Face Plate	GRM87
21	Face Plate Insulator	GRM88
22	Gap Adjust Knob	GRB32
23	Plug	GRB4
24	Small Foot	FTSJ
25	Leg	L31-7
26	Control Cable Screw Style	CC2BA-10
27	Weld Cable Assembly	CWIVC-09
28	Body Decal	GRD5
29	Collet Nut Wrench	GRM12
30	#10 Steel Lock Washer Zinc Plt.	WLC19ZP
31	10-32 X 3/4 SHCS Leg Screw	SHC19F-75
32	Ferrule Grip 1/4" (optional)	G25
	Ferrule Grip 5/16" (optional)	G31
	Ferrule Grip 3/8" (optional)	G37
33	Rear Knob Decal (not shown)	GRD108
	Body Decal Left (not shown)	GRD106
	Body Decal Right (not shown)	GRD107

Please visit us on the web at www.imageindustries.com



IMAGE INDUSTRIES INC.

11220 E. Main Street • Huntley, IL 60142 USA

Tel: (847) 659-0100 • (800) 722-7883 • Fax: (847) 659-0108

www.imageindustries.com • email: sales@imageindustries.com